


ARCTIC TRACE ®

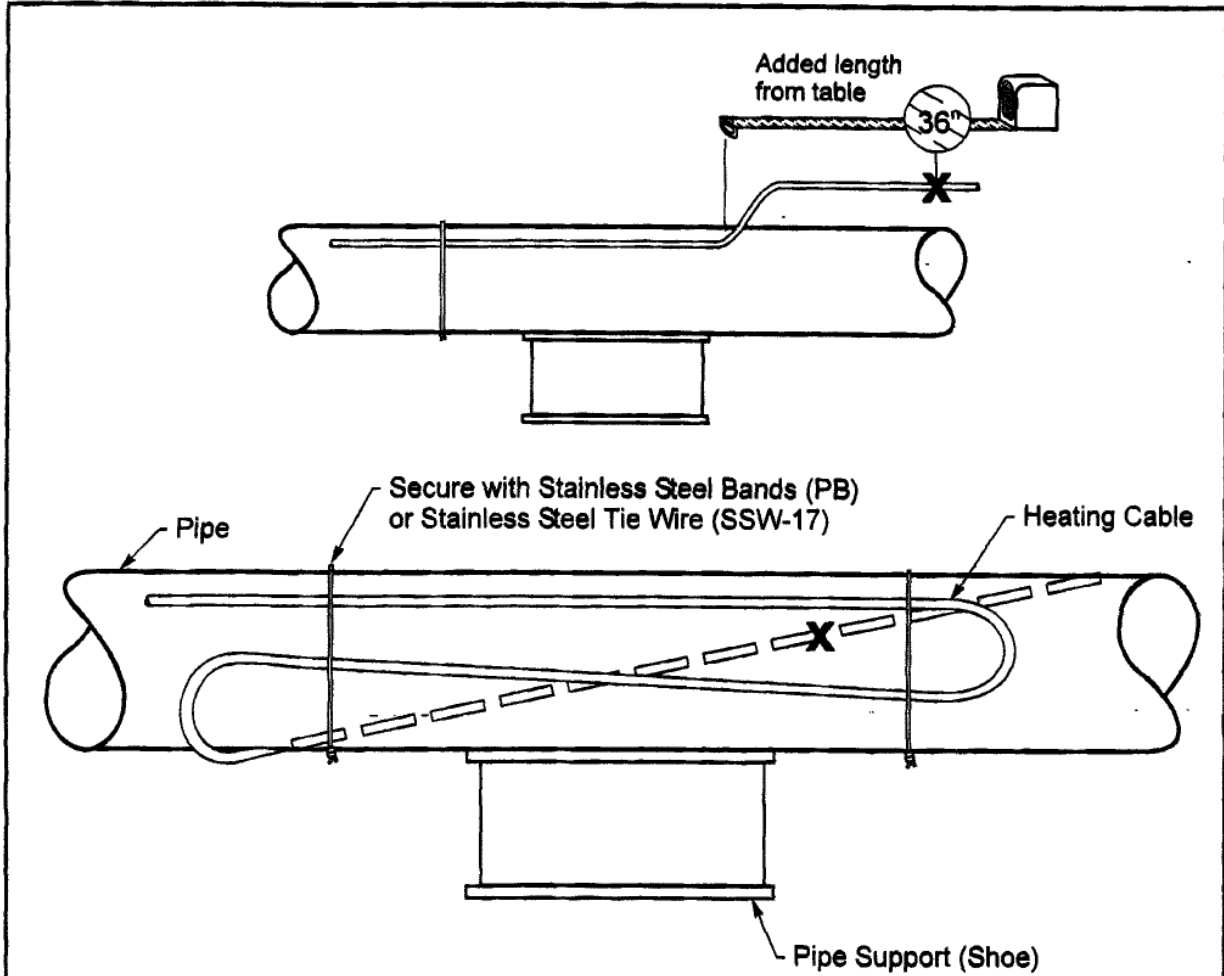

GENERAL:

Extra cable is added at supports to compensate for greater heat loss. The amount of cable applied is equal to the support length plus the value shown in the table

Cable Adders for Supports

Pipe Size	1/2"	3/4"	1"	1 1/2"	2"	3"	4"	5"	6"	8"	10"	12"	14"	16"	18"	20"	24"
Adder	1'	1.5'	1.5'	2'	2'	2'	2.5'	2.5'	3'	3'	3'	3'	3'	4'	4'	4'	4'

NOTE:

When multiple traces are used, distribute the adder length equally between the traces. On pipes larger than 6", supports have less impact on losses and often are negligible. However, on critical applications they may need to be considered. Consult factory.

SUPPORT ADDERS (SHOE TYPE)		
INSTALLATION DETAIL		
DRAWING:	SH.	REV.
	1	0

du Alaska Incorporated
 6706 Greenwood Street Anchorage Alaska 99518
 Phone (907)-522-3004 Fax (907)349-1023